


Mounting Instruction for NM/50-RG8-CX3 QM

Item no. 99761053

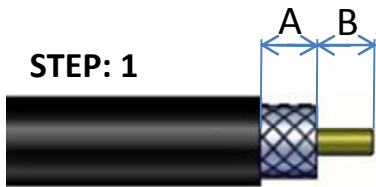

Step: 1

Use a Corning cable stripper (98501102), Stanley-knife (or similar) for the stripping operation

- I) Cut and remove the jacket/outer conductor/dielectric from the inner conductor in one operation to obtain dimension B
- II) Cut and remove the jacket to obtain dimension A, please make sure not to damage the outer conductor

Braid must be smooth to the foil/dielectric

After completed strip operation, the prepared cable dimension should be as following:

A = 6,5mm

B = 6,5mm

If necessary, clean the cable inner conductor with a conductor cleaner item no. 98500903 and the outer conductor with appropriate equipment.

Step: 2

Place the connector over the cable and push it back ward to reach mechanical stop.

Step: 3

Push the connector over the cable, push the cable to mechanical stop inside the connector, please make sure that the connector inner conductor is activated and pushed forward during inserting the cable into the connector, see drawing.

Step: 4

Compress the connector back ring using Corning compression tool,

Tools and Accessories	Item No.
CABLE CUTTER DROP RG59/6/11 CCS	98028619-01
CABLE STRIPPER ROTARY RG11 FOR COMP. AND CRIMP ONLY	98501102
RUBBER TOOL FOR CABLE SUPPORT	98028785
MOUNTING TOOL FOR NM W. PLASTIC HANDLE	98028788
COMPRESSION TOOL RG11 UNIVERSAL	98029073

ISO 9001 certified

CORNING

Corning Cabelcon ApS, Industriparken 10, DK-4760 Vordingborg

Tel: +45 55 98 55 99 Fax: +45 55 98 55 04

E-mail: cabelcon@corning.com www.cabelcon.dk

Rev. Date: 25/03-2014